

APPROCHE AUX INSTRUMENTS

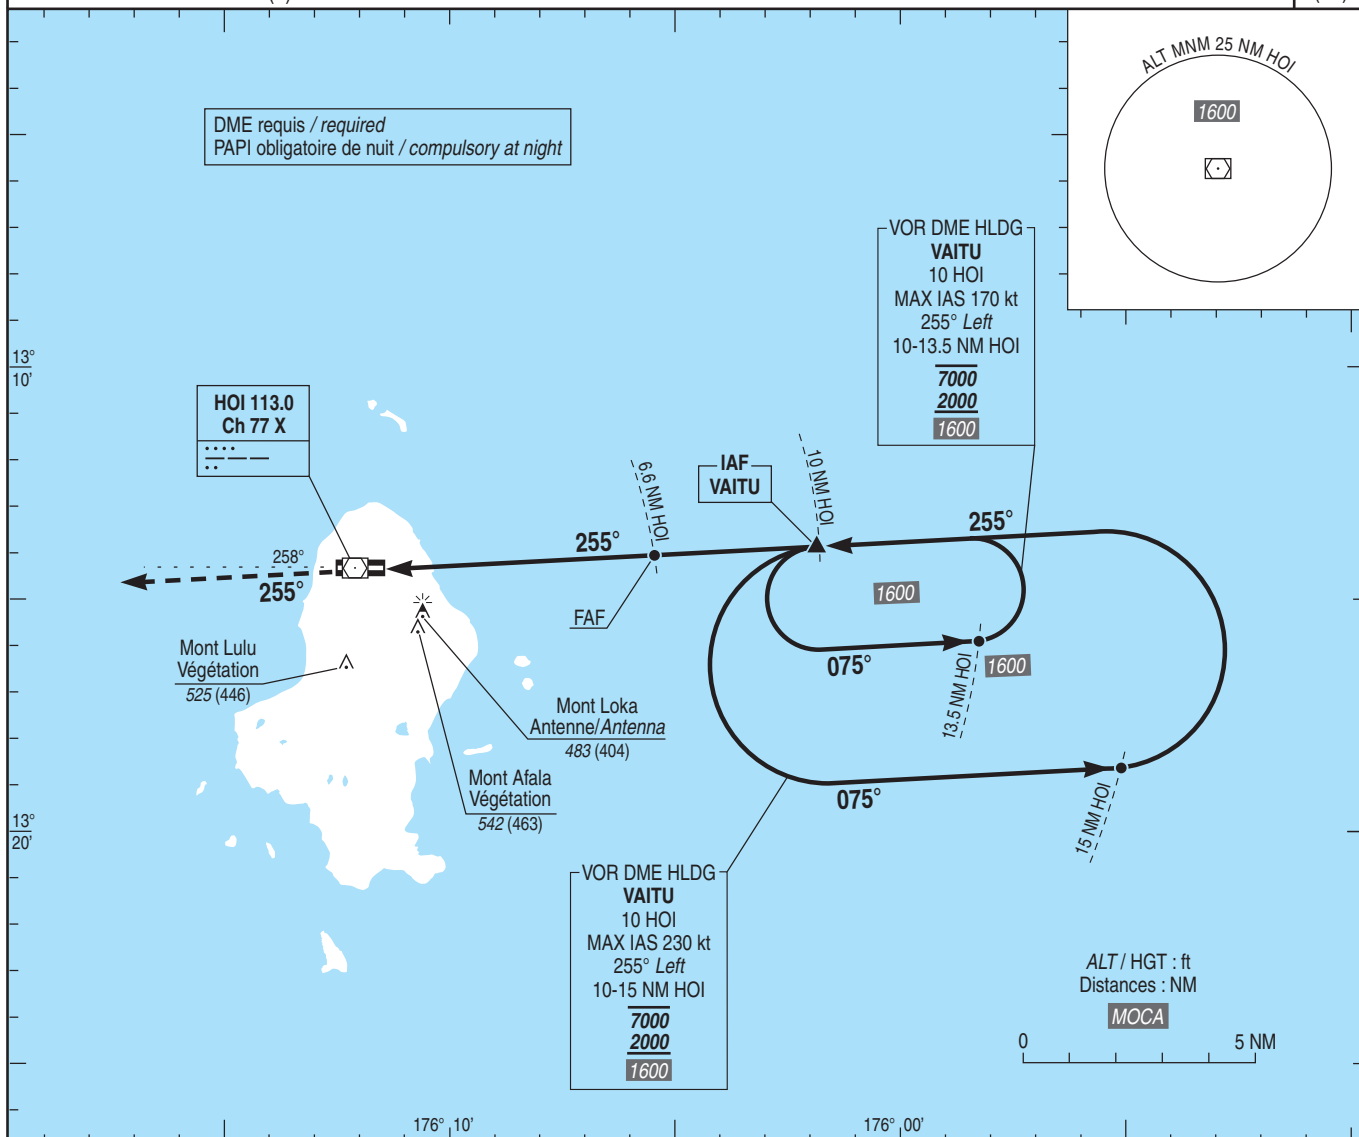
WALLIS HIHIFO

Instrument approach

CAT A B C D

ALT AD : 79 (3 hPa), DTHR : 75

VOR Z RWY 26

APP : NIL
TWR : NIL
AFIS : WALLIS Info 118.300 (L)VAR
12°E
(20)

TA : 11000

API : Monter **RDL 255° HOI** (RM 255°)
jusqu'à **1600 (1521)** puis rejoindre
VAITU à **2000 (1921)**.Missed APCH : Climb **RDL 255° HOI**
(MAG 255°) up to **1600 (1521)** then join
VAITU to **2000 (1921)**.

MAPT

FAF

VAITU

APCH non dans l'axe
APCH out of RWY axis

255°

255°

5.2%

MDA

1100

(1021)

255°

2000

(1921)

DTHR ← (NM)

1.2

5.9

9.3

DME ← (NM)

1.9

6.6

10

MNM AD : distances verticales en pieds, RVR et VIS en mètres / Vertical distances in feet, RVR and VIS in meters.

REF HGT : ALT AD

CAT	VOR Z			MVL/Circling ⁽¹⁾		DME HOI				
	MDA (H)	RVR	OCH	MDA (H)	VIS	NM	6	5	4	3
A	530 (450)	1500	446	840 (760)	1500	ALT	1820	1500	1180	860
B	580 (500)	1600		840 (760)	1600	(HGT)	(1741)	(1421)	(1101)	(781)
C	680 (600)	2400		940 (860)	2400					
D	780 (700)	3600		940 (860)	3600					

Observations / Remarks : (1) Absence ATS : HJ seulement / ATS not available : HJ only.

		70 kt	85 kt	100 kt	115 kt	130 kt	145 kt	160 kt	185 kt
IAF - FAF		3.4 NM	2 min 55	2 min 24	2 min 02	1 min 46	1 min 34	1 min 24	1 min 17
FAF - MAPT		4.7 NM	4 min 02	3 min 19	2 min 49	2 min 10	1 min 57	1 min 46	1 min 31
VSP (ft/min)			370	450	530	610	690	770	850