

APPROCHE AUX INSTRUMENTS


NAPUKA

Instrument approach


CAT A B

ALT AD : 13 (1 hPa), DTHR : 12

NDB A

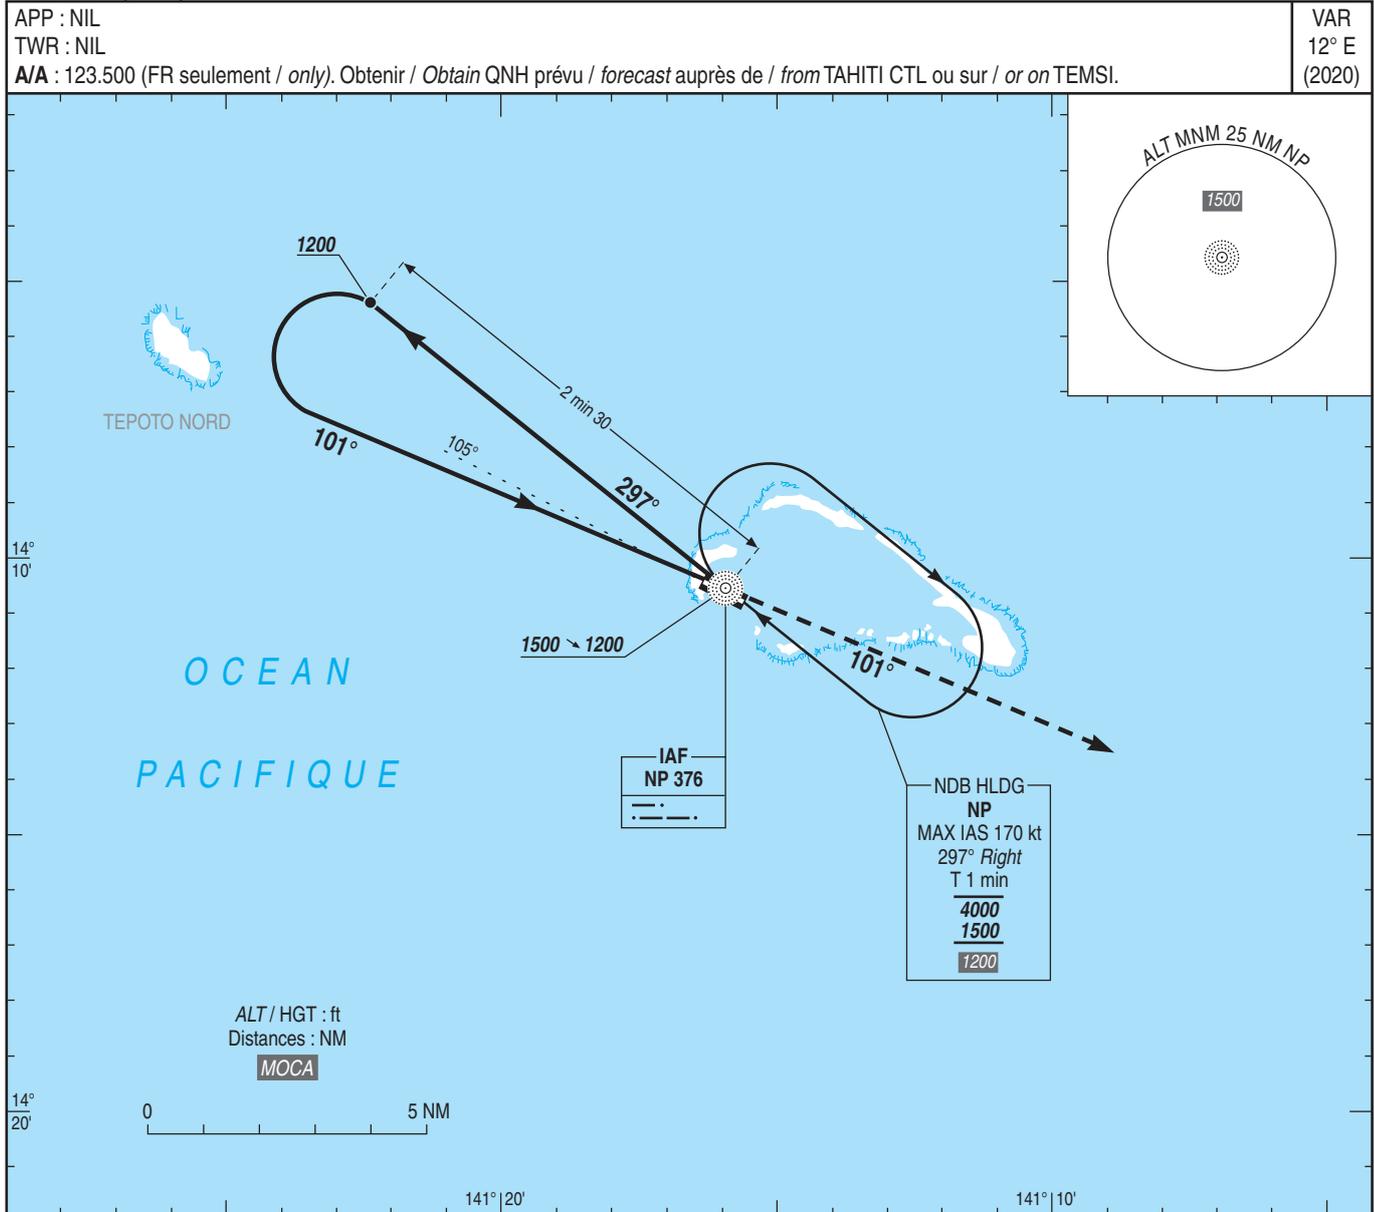

TA : 3000

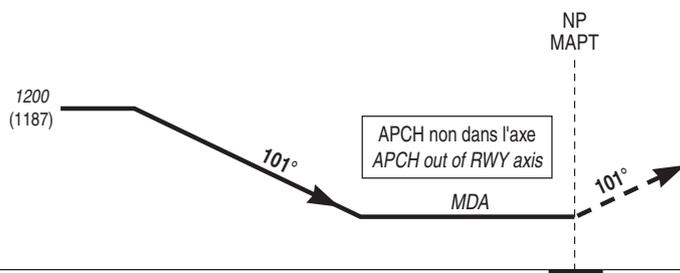

API : Monter **QDR 101° NP (RM 101°)** vers **1500 (1487)**, puis rejoindre **NP**.
Palier d'accélération non étudié.

Missed APCH : Climb **QDR 101° NP (MAG 101°)** up to **1500 (1487)**, then join **NP**.
Acceleration level not studied.

MNM AD : distances verticales en pieds, VIS en mètres / vertical distances in feet, VIS in metres.

REF HGT : ALT AD

| CAT | MVL / Circling HJ seulement / only Sans / Without QNH local | | |
|-----|---|------|-----|
| | MDA (H) | VIS | OCH |
| A | 620 (600) | 1500 | 598 |
| B | 690 (670) | 1600 | 668 |

Observations / Remarks : procédure obligatoirement suivie d'une MVL / the procedure must be followed by circling.